

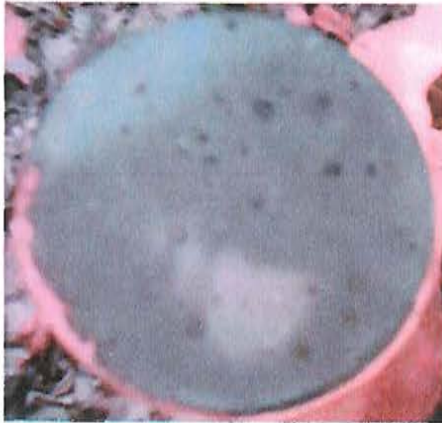
LAND CORNER RECORD

Index: P-12	Corner: Center East Sixteenth corner	State of Indiana - Hoosier National Forest		
Section: 21	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1376921.73	Lon./E: 3143958.79	Datum: NAD83(2011) US survey feet	

CORNER HISTORY: (Chronological history of corner)

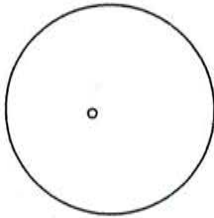
1.) Date of Survey:	Surveyor:	Monument:	Recording Information:		Monument Photograph:
c. 1980	USFS Surveyor	3" Steel Pipe with 3" brass cap	On file in USFS office.		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
Record evidence of prior survey:	Found 3" pipe with brass cap				

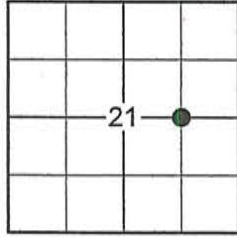
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:	
11/27/1995	Robert J. Stone USFS Surveyor	3" Steel Pipe with 3" brass cap	On file in USFS office.	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	Black Oak	26"	S02°E	21' +/-
Record evidence of prior survey:	Found 3" pipe with brass cap			



ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Mag nail in Chestnut Oak	27"	N55°E	20.41'
	Mag nail in White Oak	12"	S19°E	12.65'
	Mag nail in Black Oak	48"	N75°W	11.13'
	Limestone with point on top	0.2x0.9	N13°W	10.11'
Monument Found or Set:	Found a 3" galvanized pipe with brass cap on top, 0.4' above grade.			

MONUMENT SKETCH	NARRATIVE REFERENCE:
	Monument is a 3" galvanized pipe with brass cap on top, 0.4' above grade, a carsonite post is located 1.0' West of the monument. Located near North end of SE to NW ridge top, approximately 120' East of North/South ravine. approximately 120' South of NW to SE ravine. .

SECTION DIAGRAM	PERPETUATION RECORD:
	This was set by the USFS as shown on both the c.1980 USFS survey of the Southeast Quarter of Section 21 (on file in the USFS office) , and the c.1980 USFS survey (on file in the USFS office) of the 15 acre USA tract described in DB 215, Page 538. A 3 inch X 11 inch limestone with no markings was found 7 inches above grade 9.3 feet north and 2.7 feet west of this pipe. The origin of this stone is unknown. The pipe was accepted as the corner due to its close proximity to the midpoint of a line from the stone found at P-11 (Center Quarter Corner of Section 21) and the pipe found at P-13 (Quarter Corner common to Section 21 and Section 22). The pipe found at P-12.38 (Northeast Corner of the USA property described in Deed Book 215, Page 538) was also placed on this same line, and appears to have been accepted as the property corner. Accepting the stone 10 feet to the north would change this line that has been accepted as the line for 30 years and would create unnecessary doubt in a position that appears to be locally accepted. The pipe was accepted as marking the position of P-12 and the stone was left in place. The line to the south and west of the accepted 3 inch galvanized pipe with a brass cap has been posted for several years with USFS Property Boundary posts. The record monument was found undisturbed and maintained by establishing three new bearing trees, and one stone was established as a reference. Bearing Trees were marked with a blaze, scribed B.T., bearing tree sign, paint, and nail where permission was granted by adjoining landowner.
Section: 21 T7N R1E	Prepared By: BRG (Project#3-565) Date: 6/2015

Referenced on BRG survey recorded as InstNo.2016001724

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Index No P -12 Polk L15 LAND CORNER RECORD FSM 7150
T. 7N R. 1E 2nd P. Mer. County MONROE State of Indiana
C R 16 Corner common to Sections 21 Hoosier National Forest

EXISTING SURVEYS
Original Government Survey
Year Surveyed _____ By _____
Original Monument _____
Species _____ Dia _____ Bearing _____ Dist _____
BT's _____
Original Survey evidence Found
Date of Search _____ By _____
Monument Found _____
Orig. Species _____ Dia _____ Bearing _____ Dist _____
BT's _____
Found _____

Subsequent Corner Restoration
Date Surveyed _____ By _____
Where Filed or recorded: _____
Book: _____ Page _____
Monument Set _____
BT's Species Dia Bearing Dist _____
Ref. _____
Obj. _____
Evidence of Subsequent Corner Restoration Found
Date of Search 11/27/95 By _____
Monument Found 3" DIA. STEEL PIPE
W/ 3" DIA. BRASS CAP UNSTAMPED
BT's Species Dia Bearing Dist _____
Found _____

OTHER EVIDENCE
Describe corner location relative to nearby features and how to reach the corner location - note fences roads, timber, streams, topo changes, etc: CORNER is LOCATED 150' +/- NW OF PINE STAND ON SIDE RIDGE TOP. A LARGE E-W HOLLOW is 250' +/- N. A 26" B. CAK is S 02° E 21' +/- A 4" 44" WOODEN POST W/ PROPERTY BOUNDARY SIGN is SOUTH 3 FEET AND PAINTED RED.
Sketch of Monument

PERPETUATION RECORD
Monument: Describe new monument set, or work done to preserve existing monument.
LEFT AS FOUND

CORNER DIAGRAM
Accessories: Describe new Bt's and/or witness objects established or work done to preserve existing evidence

21	Photo Identified	Corner Recordation	Yes
	Photo # _____	Certificate prepared:	No
	Strip/Series _____	Filed or recorded in County	
	Pinpricked _____	Records: Date: _____	
	Search Hours _____	Book: _____ Page: _____	

Corner Record by: Robert J. Stone Date: 11/27/95